

NOTE:  
THIS DRAWING INDICATES AND ASSUMES THE USE OF  
BPT COMPOSITE CABLES OR A SUITABLE EQUIVALENT.

ENSURE ALL ADDITIONAL CONNECTIONS ARE  
A MINIMUM OF 0.5MM CSA PARALLEL CONDUCTORS.

INCORRECT CABLE SPEC CAN CAUSE DIGITAL  
SIGNALING PROBLEMS.


NOTE; CABLE EQUIVALENTS

VCM/130 = RG59 COAX + 4 CORES @ 1.0MMSQ + 8 CORES @ 0.5MMSQ  
VCM/60 = RG59 COAX + 2 CORES @ 1.0MMSQ + 3 CORES @ 0.5MMSQ

75 Ohm ENSURE LAST VAV/400P IN/OUT  
BLOCK HAS A 75 Ohm RESISTOR  
FITTED ACROSS TERMINALS 3 & 4.

TO FURTHER MONITORS AND  
CD/204 AS REQUIRED

NOTE: ADD EXTRA VAS100 PSU AFTER THE  
FIRST 16 MONITORS. ADD AN EXTRA VAS100 PSU  
FOR EVERY FURTHER 28 MONITORS ON THE SYSTEM  
AS SHOWN.

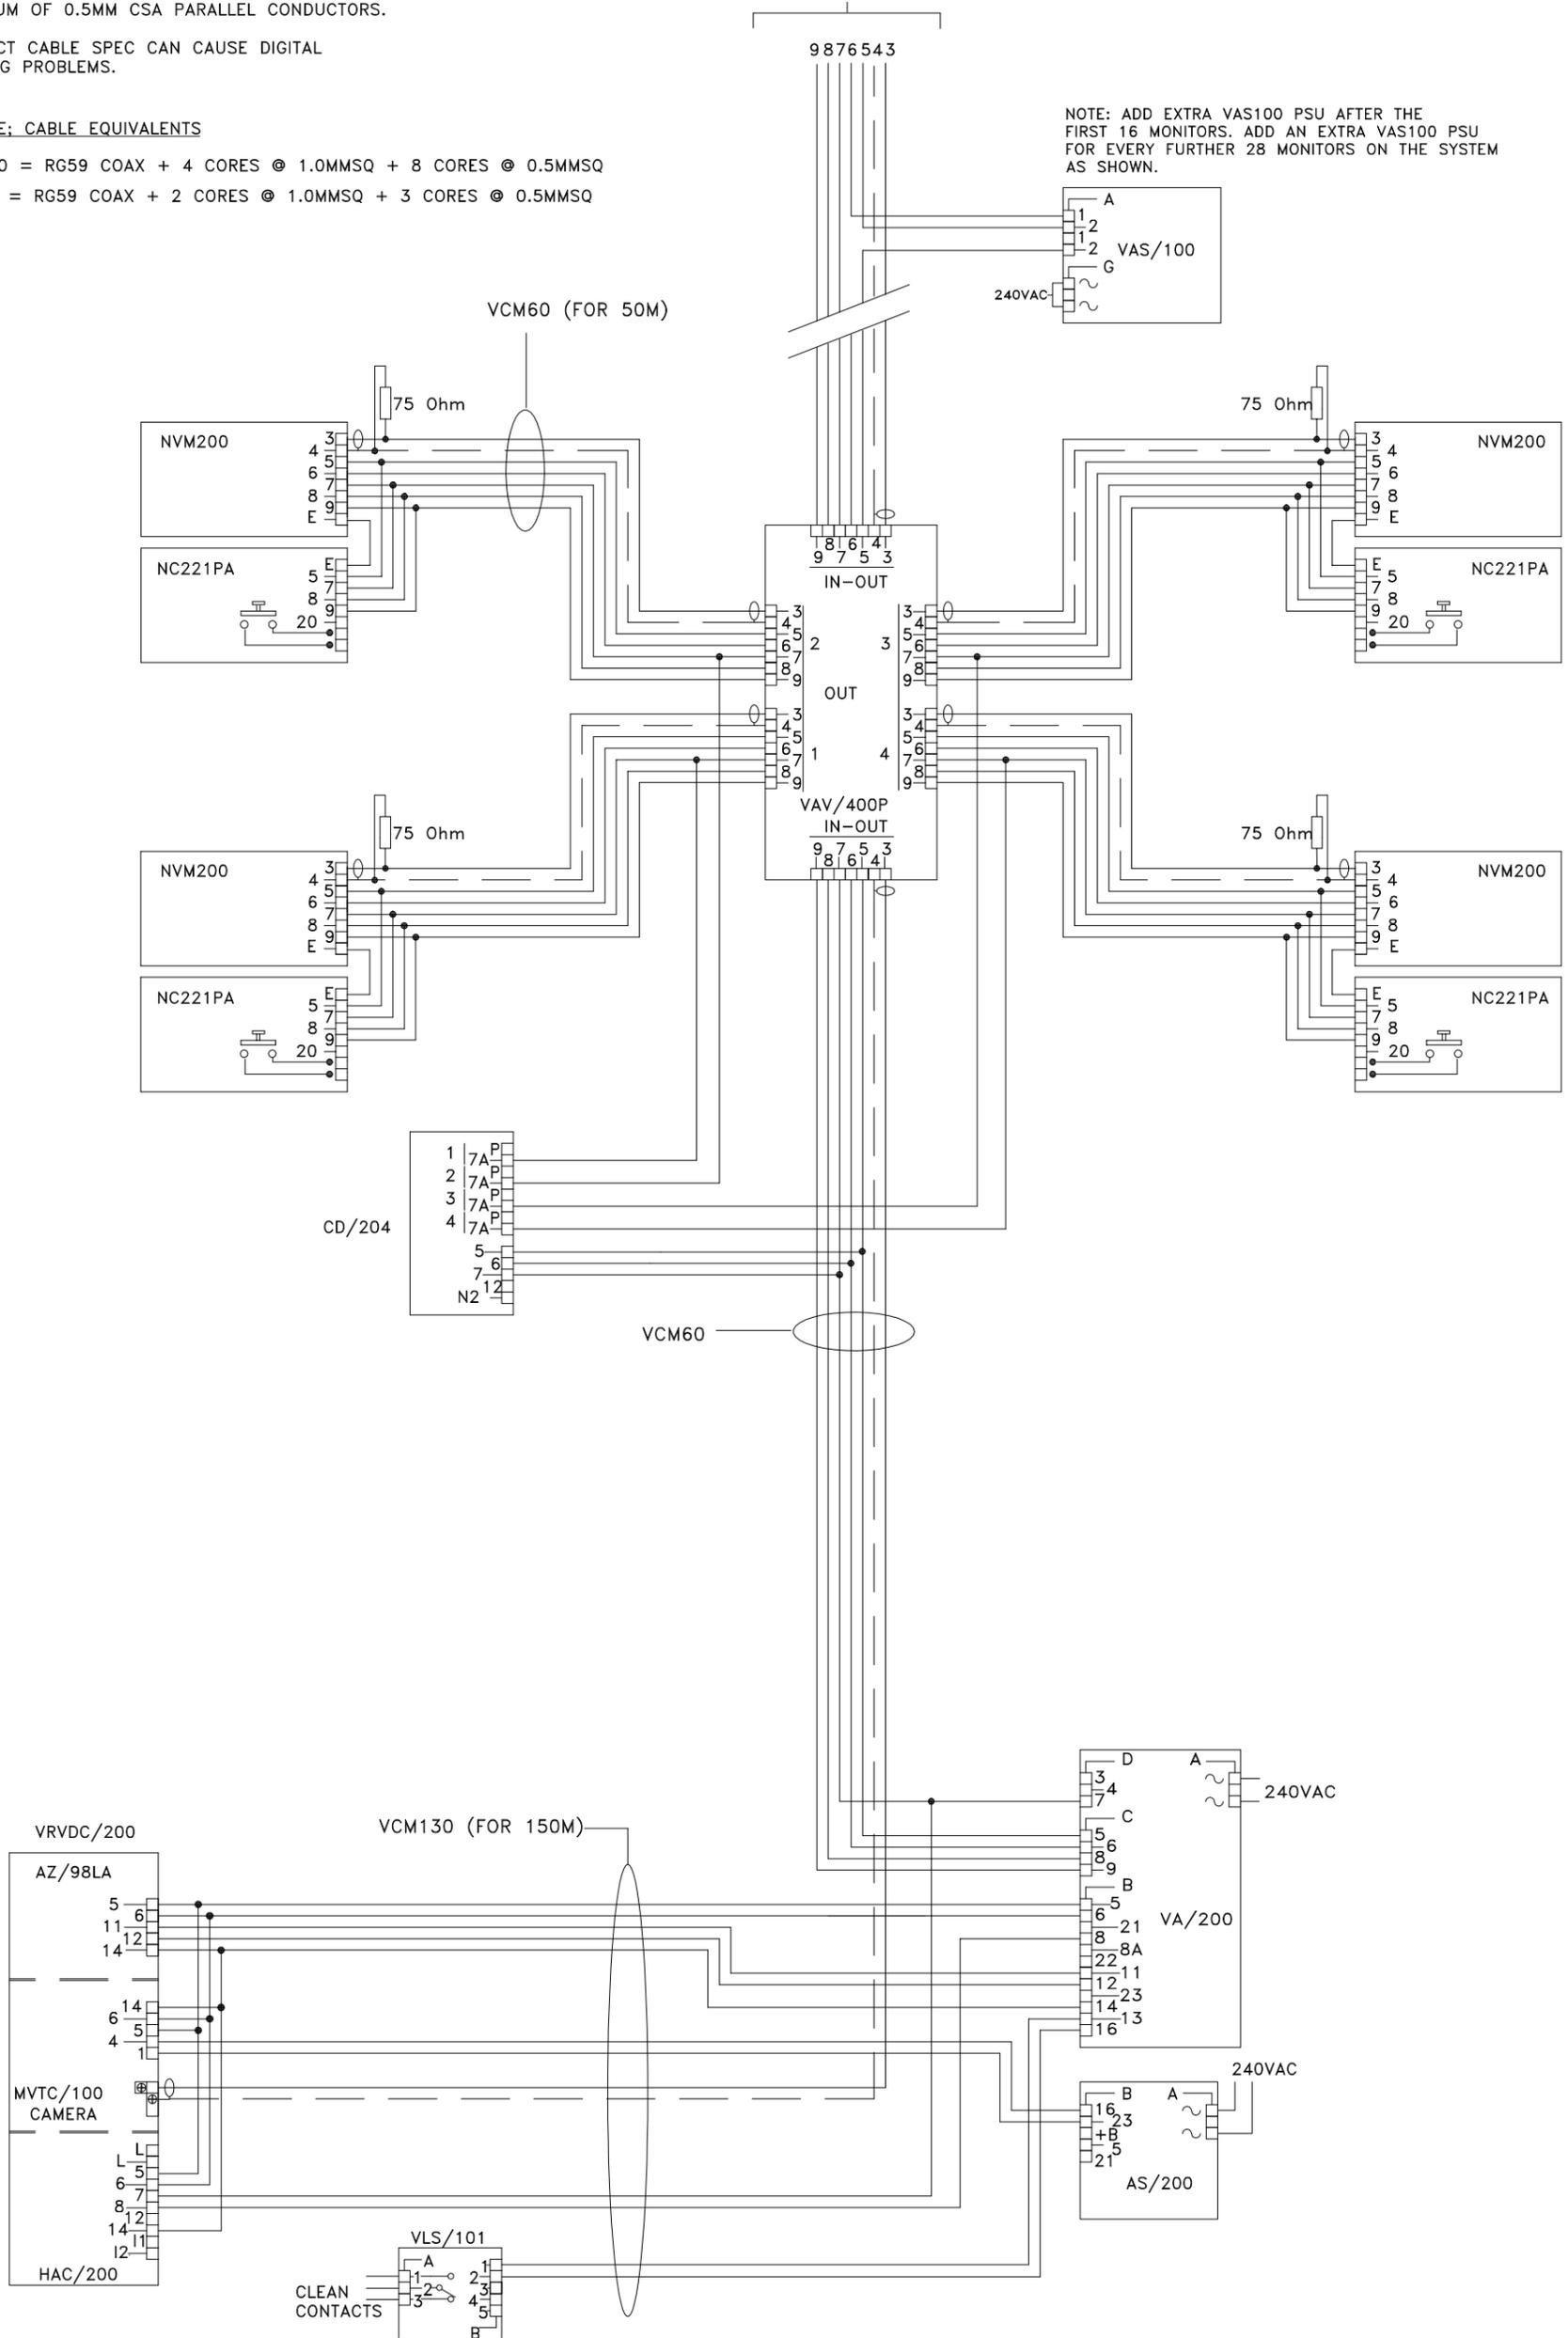

BPT (UK) LTD.  
HERTS. ENGLAND

PREPARED FOR  
INSTALLER INFORMATION

DATE: 22/03/07

DRAWN: RC

REVISED:

DRAWING TITLE:

MULTI-FLAT INSTALLATION USING 1 VR DIGITAL  
COLOUR VIDEO ENTRY PANEL & NOVA MONITORS

DRAWING No: B-XV1NNC