


75 Ohm ENSURE LAST VAV/400P IN/OUT BLOCK HAS A 75 Ohm RESISTOR FITTED ACROSS TERMINALS 3 & 4.

TO FURTHER MONITORS AND CD/204 AS REQUIRED


NOTE: ADD EXTRA VAS100 PSU FOR EVERY FURTHER 28 MONITORS ON THE SYSTEM AS SHOWN.

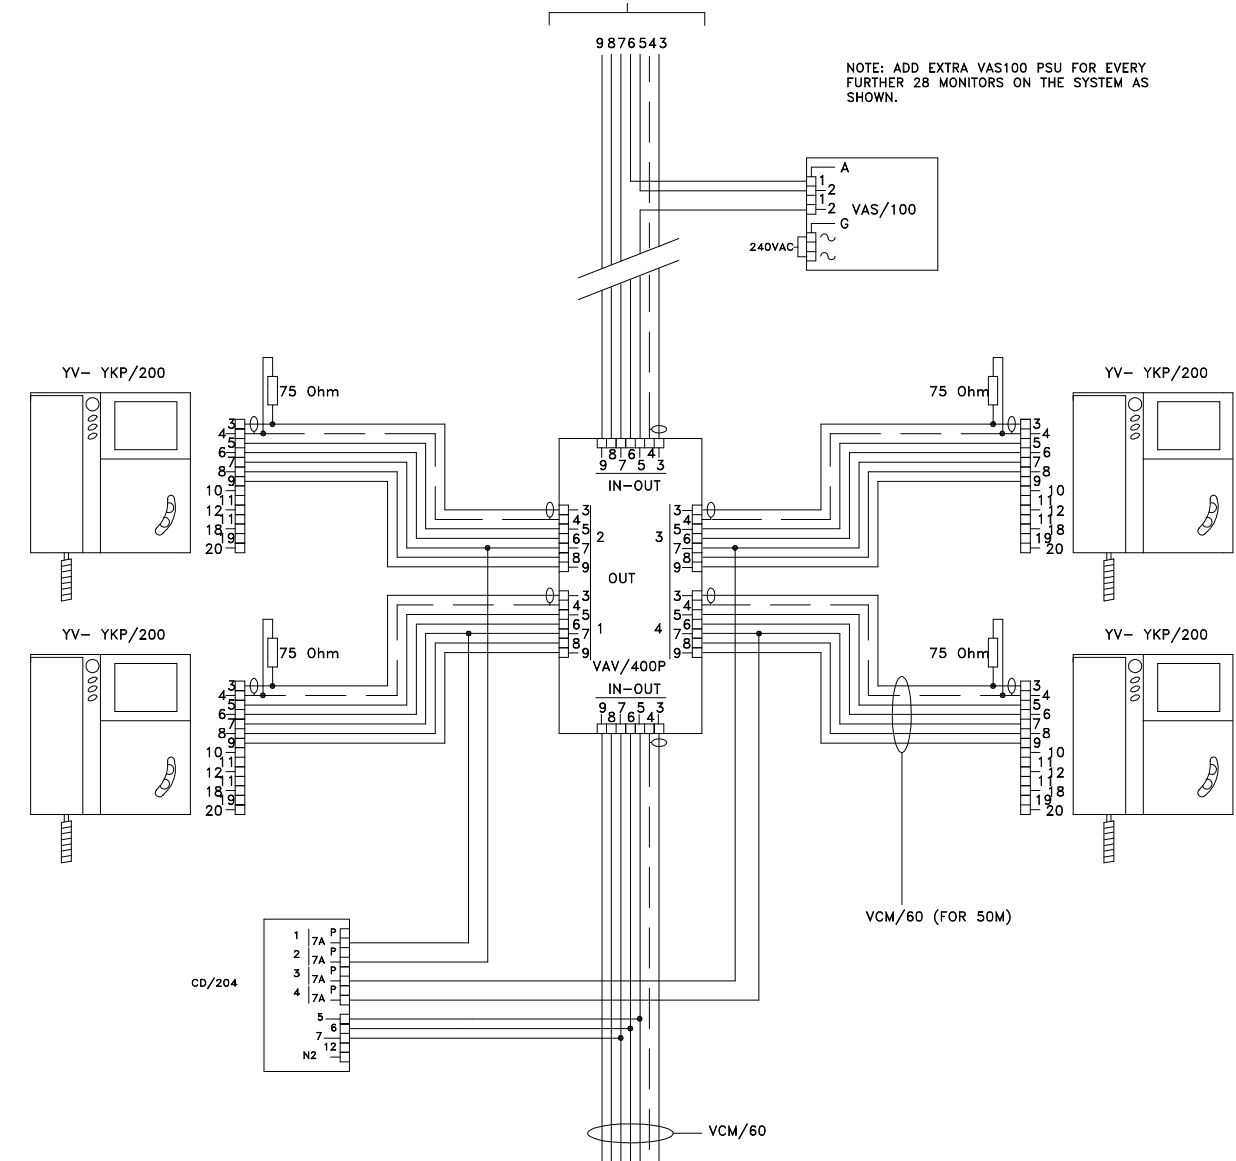

NOTE:  
THIS DRAWING INDICATES AND ASSUMES THE USE OF BPT COMPOSITE CABLES OR A SUITABLE EQUIVALENT.  
ENSURE ALL ADDITIONAL CONNECTIONS ARE A MINIMUM OF 0.5MM CSA PARALLEL CONDUCTORS.  
INCORRECT CABLE SPEC CAN CAUSE DIGITAL SIGNALING PROBLEMS.

NOTE: CABLE EQUIVALENTS

VCM/130 = RG59 COAX + 4 CORES @ 1.0MMSQ + 8 CORES @ 0.5MMSQ  
VCM/60 = RG59 COAX + 2 CORES @ 1.0MMSQ + 3 CORES @ 0.5MMSQ

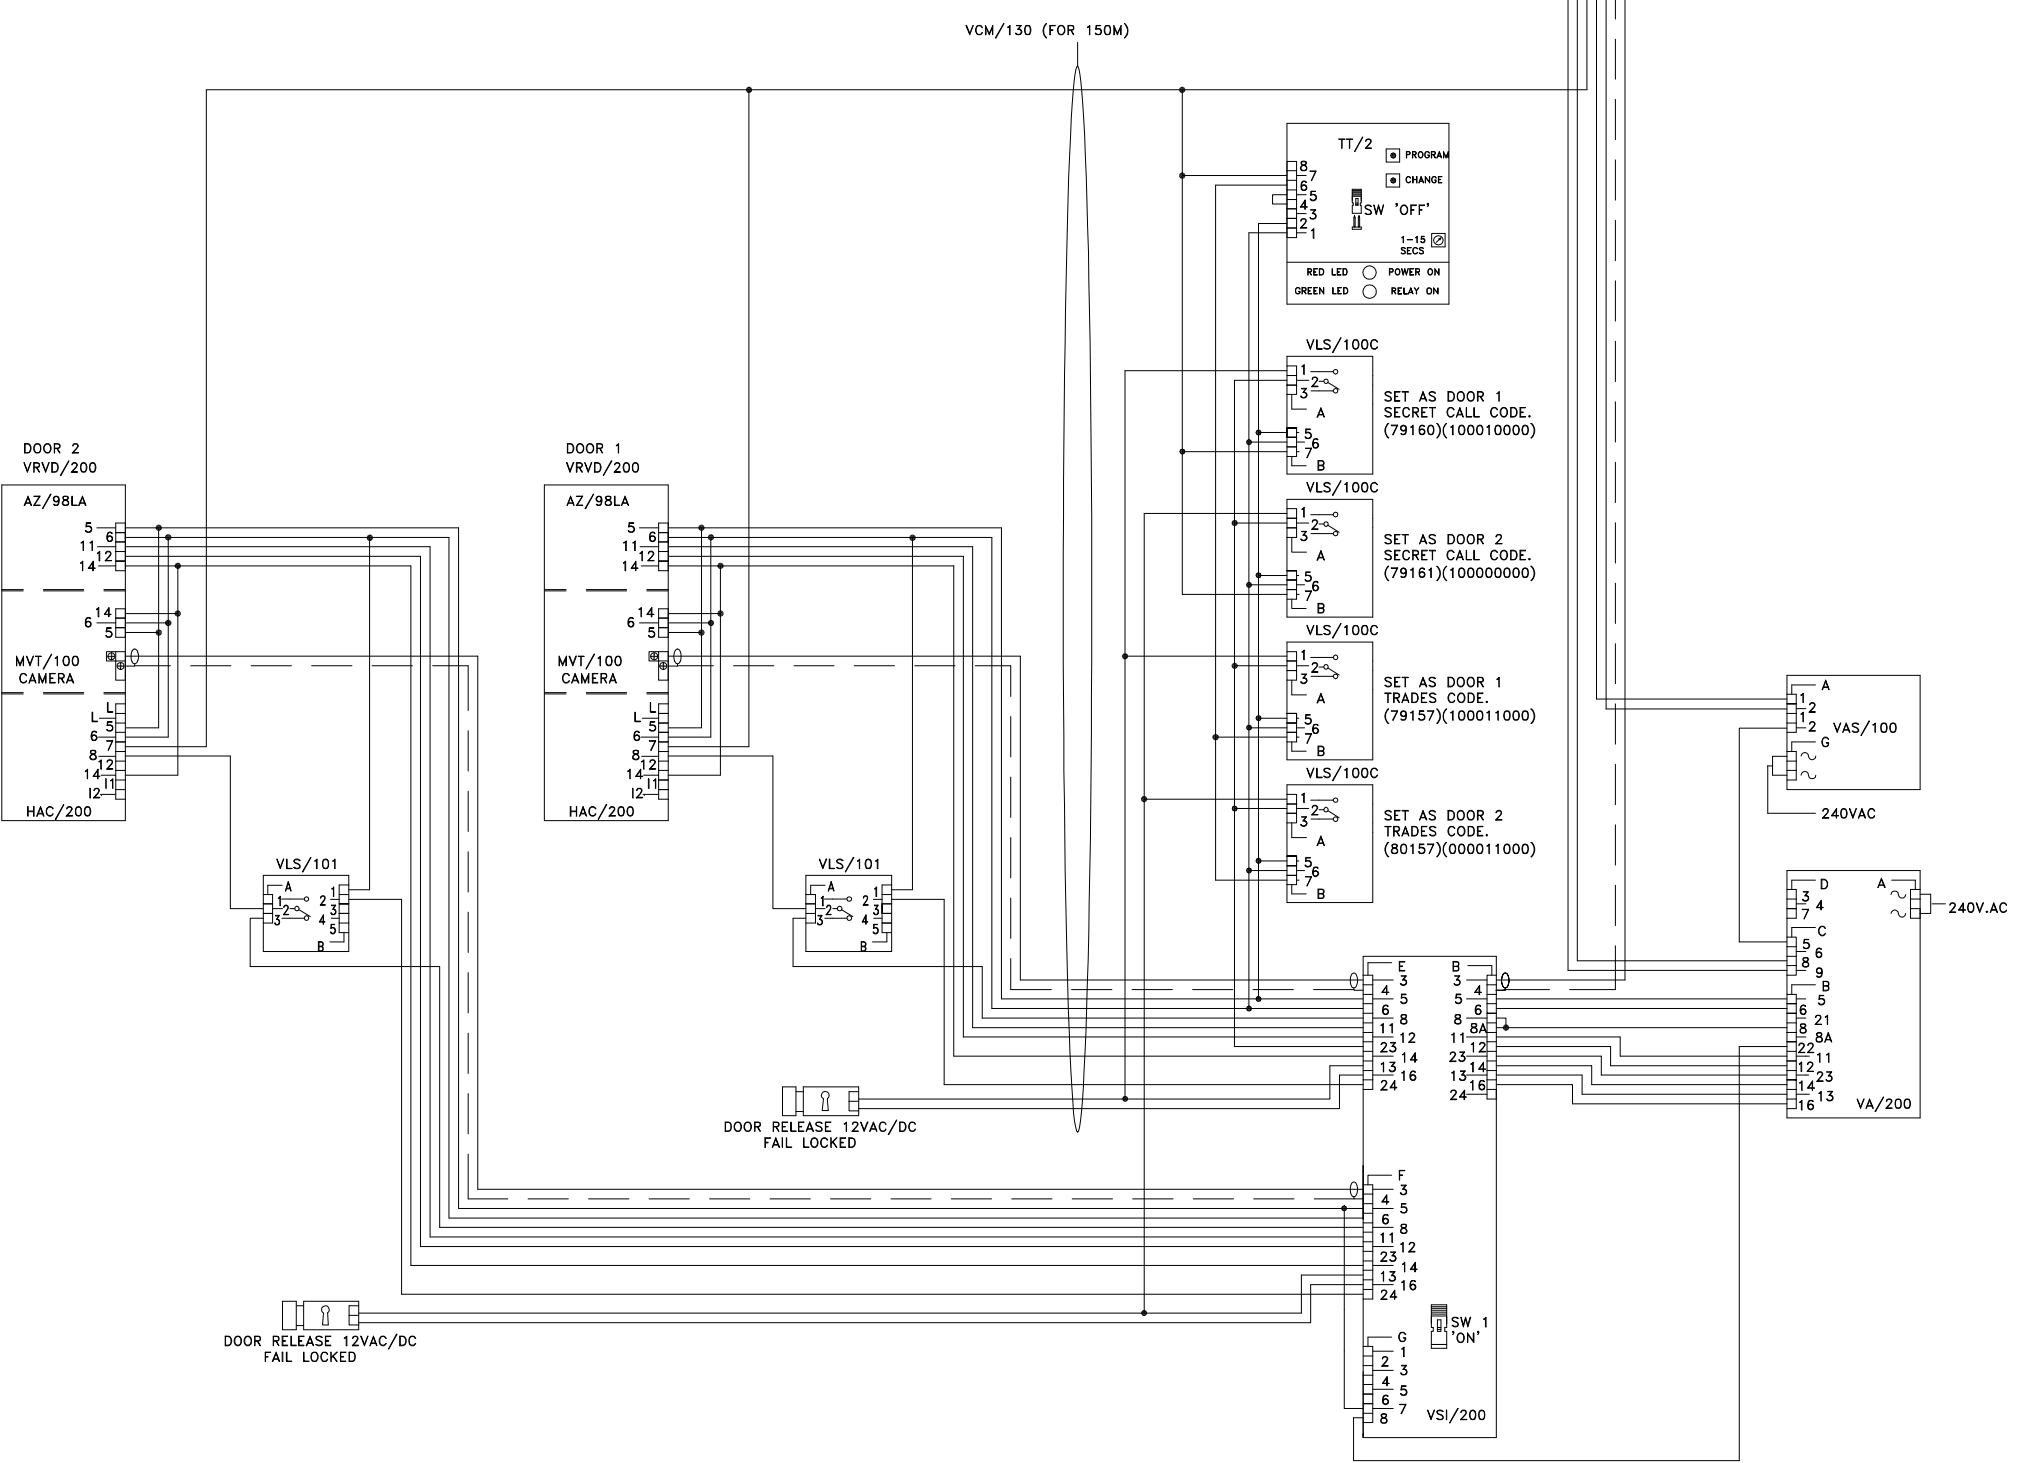

BPT (UK) LTD. HERTS. ENGLAND	PREPARED FOR INSTALLER INFORMATION	DATE: 19/09/05	DRAWN:RC
		REVISED:	
DRAWING TITLE:	MULTI-FLAT INSTALLATION USING 2 VR DIGITAL VIDEO ENTRY PANELS WITH TRADES & CODED ENTRY	DRAWING No: B-XV2YNLTTVL	